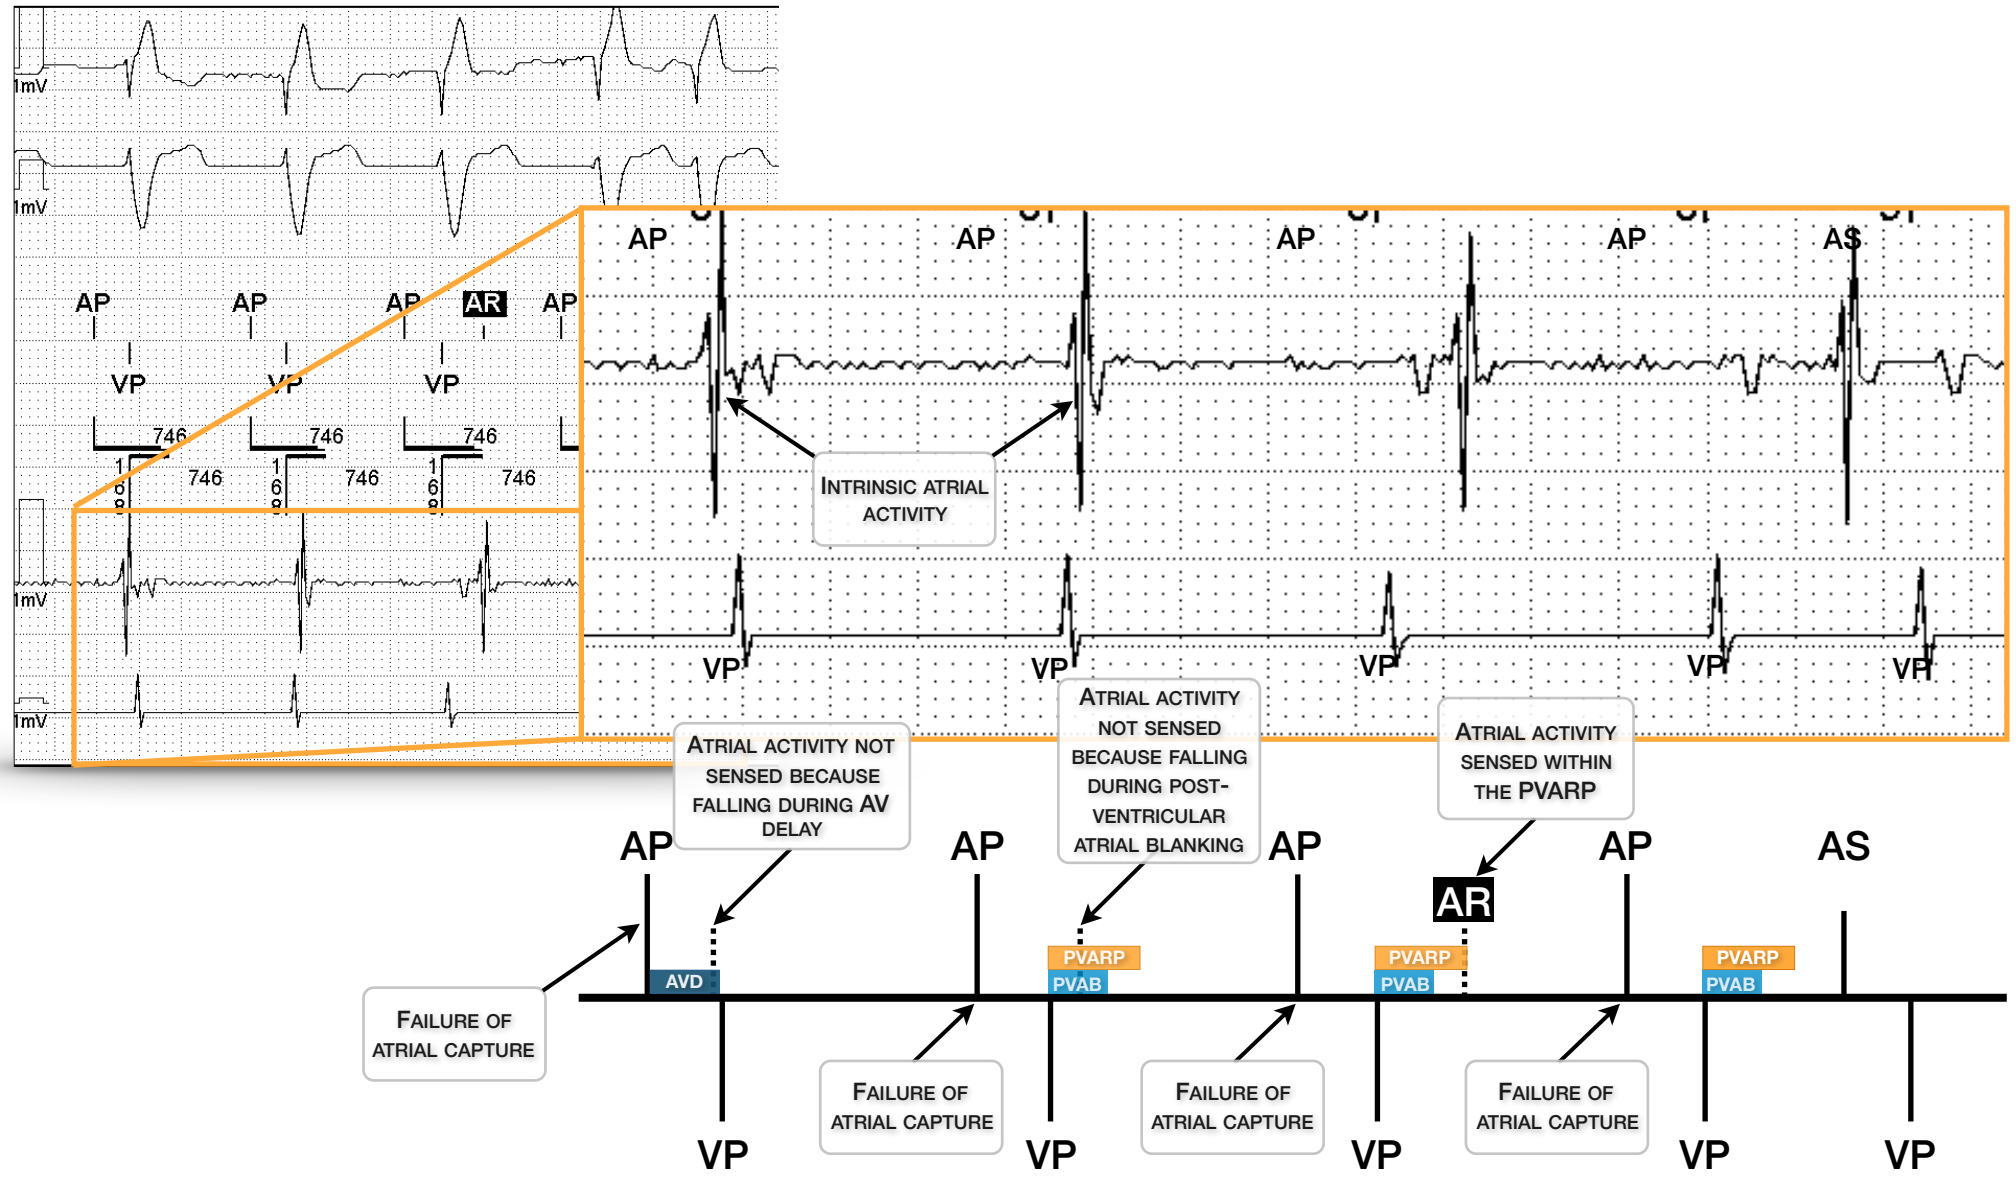
1mV
1mV
1mV
1mV
AP
AP
AP
AR
AP
VP
VP
VP
746
746
746
746
746
746
AP
AP
AP
AP
AS
INTRINSIC ATRIAL ACTIVITY
VP
VP
VP
VP
VP
ATRIAL ACTIVITY NOT SENSED BECAUSE FALLING DURING AV DELAY
ATRIAL ACTIVITY NOT SENSED BECAUSE FALLING DURING POST-VENTRICULAR ATRIAL BLANKING
ATRIAL ACTIVITY SENSED WITHIN THE PVARP
AP
AP
AP
AR
AP
AS
AVD
PVARP
PVAB
PVARP
PVAB
PVARP
PVAB
FAILURE OF ATRIAL CAPTURE
FAILURE OF ATRIAL CAPTURE
FAILURE OF ATRIAL CAPTURE
FAILURE OF ATRIAL CAPTURE
VP
VP
VP
VP
VP